

No. 10-03-02-02R/04

SYSTEM: Space Shuttle RSRM 10 CRITICALITY CATEGORY: 1

SUBSYSTEM: Ignition Subsystem 10-03 PART NAME: Redesigned Barrier-Booster Assembly (1)

ASSEMBLY: Safety and Arming Device 10-03-02 PART NO.:

10-03-02-02R Rev M FMEA ITEM NO.:

CIL REV NO.:

31 Jul 2000 DATE: SUPERSEDES PAGE: 415-1ff. 30 Jul 1999 DATED:

CIL ANALYST: S. E. Rodgers

APPROVED BY:

DATE:

PHASE(S):

QUANTITY:

EFFECTIVITY:

HAZARD REF.: BI-03

(See Table A-3)

(See Table A-3) (See Table 101-6)

Boost (BT)

RELIABILITY ENGINEERING: K. G. Sanofsky 31 Jul 2000

ENGINEERING: _ J. W. Edwards 31 Jul 2000

1.0 FAILURE CONDITION: Failure to operate (B)

1.0 Rotor blocks SRM Ignition Initiator (SII) output 2.0 FAILURE MODE:

3.0 FAILURE EFFECTS: Failure to ignite one RSRM results in thrust imbalance causing loss of the RSRM,

SRB, crew, and vehicle

4.0 FAILURE CAUSES (FC):

FAILURE CAUSE KEY FC NO. DESCRIPTION

Nonconforming dimensions/location of holes in barrier Α 1.1

1.2 Contamination blocking ports in Barrier-Rotor В

5.0 REDUNDANCY SCREENS:

SCREEN A: N/A SCREEN B: N/A SCREEN C: N/A



31 Jul 2000 DATE: SUPERSEDES PAGE: 415-1ff. No. 10-03-02-02R/04

DATED: 30 Jul 1999

6.0 ITEM DESCRIPTION:

The output Barrier-Rotor is an integral part of the Barrier-Booster Assembly (Figures 1, 2, and 3). Materials are listed in Table 1.

TABLE 1. MATERIALS

==	Drawing No.	Name	Material	Specification	Quantity
	1U50688 1U77383 1U77385	Rotor, Output Barrier Housing, Barrier-Booster Barrier-Booster Assembly S&A Device	A286 CRES A286 CRES	AMS-5737 AMS-5737	1/Motor 1/Motor 1/Motor
	1U77386	Barrier-Booster Assembly, S&A Device, Loaded			1/Motor

6.1 CHARACTERISTICS:

- The RSRM Safety and Arming (S&A) device meets established requirements for performance, design, development, test, manufacture, and acceptance for a two-part electromechanical safety and arming device per STW3-9011.
- The output Barrier-Rotor is an integral part of the Barrier-Booster Assembly. The output Barrier-Rotor is positioned by the Safety and Arming (S&A) device so that:
 - a. When the S&A is on "SAFE", a mechanical barrier between the initiator and the cross-over tube leading to the basket assembly inhibits firing of the RSRM Ignition System.
 - b. When the S&A is on" ARM", a connecting channel between the initiator and cross-over tube leading to the basket assembly allows firing of the RSRM Ignition System.

7.0 FAILURE HISTORY/RELATED EXPERIENCE:

Current data on test failures, flight failures, unexplained failures, and other failures during RSRM ground processing activity can be found in the PRACA Database.

8.0 OPERATIONAL USE: N/A



No. 10-03-02-02R/04

DATE: 31 Jul 2000 SUPERSEDES PAGE: 415-1ff. DATED: 30 Jul 1999

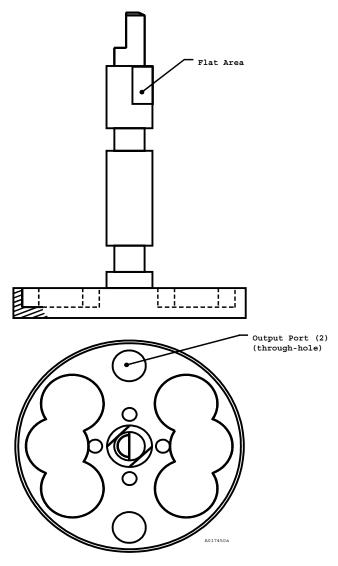


Figure 1. Output Barrier Rotor



No. 10-03-02-02R/04

DATE: 31 Jul 2000 SUPERSEDES PAGE: 415-1ff. DATED: 30 Jul 1999

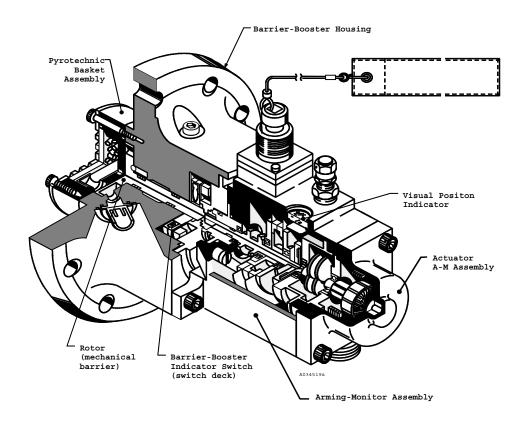


Figure 2. S&A Device



No. 10-03-02-02R/04

DATE: 31 Jul 2000 SUPERSEDES PAGE: 415-1ff. DATED: 30 Jul 1999

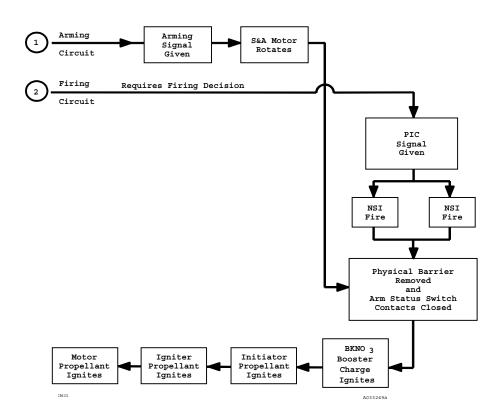


Figure 3. RSRM Ignition Subsystem Operational Sequence



DATE: 31 Jul 2000 No. 10-03-02-02R/04 SUPERSEDES PAGE: 415-1ff. DATED: 30 Jul 1999

9.0 RATIONALE FOR RETENTION:

9.1 DESIGN:

Α

DCN FAILURE CAUSES

1. New Barrier- Booster assembly is as follows:

В The Barrier-Booster Rotor is cleaned per engineering drawings. a. В Threaded protectors are installed in the SII holes, two places. b. В A shipping cover is installed over the rotor per engineering drawings. C. Procedures and requirements for cleanliness and contamination control are В established per engineering drawings. Refurbishment of the Barrier-Booster Assembly is as follows: Refurbishment of the Barrier-Booster Assembly, of which the rotor is a A,Bcomponent, is per engineering and acceptance criteria. В Procedures and requirements for cleanliness and contamination control are b. established per engineering drawings. Reusable components of the Barrier-Booster Assembly including the rotor are Α reassembled to the assembly from which they came at refurbishment per engineering drawings.

Rotor dimensions are controlled per engineering drawings.



DATE: 31 Jul 2000 No. 10-03-02-02R/04 SUPERSEDES PAGE: 415-1ff.

DATED: 30 Jul 1999

9.2 TEST AND INSPECTION:

	FAILURI	E CAUSES and
DCN	TESTS	(T)

В

CIL CODES

ABG049

N TESTS	<u> (T)</u>			CIL CODES
		1.	For New Barrier-Booster Assembly, Loaded, verify:	
В			Prior to mating, area of Barrier-Booster Assembly that mates with Pyrotechnic Basket is cleaned	ADA017
B B			 b. Environmental seals in place and undamaged c. Initiators are free of damage and contamination prior to installation 	ADA035
		2.	For New Barrier-Booster Assembly, verify:	
A,B			a. Through holes in rotor fully aligned with initiator ports in Barrier-Booster assembly in full "ARM" position	ACZ170
В			b. Barrier-Booster Assembly for absence of foreign material in through holes in the full "ARM" position	DAA017
		3.	For Refurbished Barrier-Booster Assembly, verify:	
B B A,B B			 a. Barrier-Booster housing cleaned of carbon deposits b. Barrier-Booster housing cleaned of lubricant c. Barrier-Booster housing cleaned of other contaminants d. Through holes in rotor fully aligned with initiator ports in Booster-Booster assembly in full "ARM" position e. Barrier-Booster Assembly for absence of foreign material in 	ACY009 ACY010 ACY011 ACZ171
		4.	through holes in the full "ARM" position For New Barrier-Booster Rotor, verify:	DAA017A
A A			a. Diameter of two through holes	ABG016 ABG003,DAA043
		5.	For Refurbished Barrier-Booster Rotor, verify:	
A,B			a. Rotor inspected and refurbished	ABG048

REVISION $\underline{\boldsymbol{M}}$ TWR-15712 IV DOC NO. SEC 415

b. Rotor was cleaned